

Warranty (Defect) inspection report

Inspection Details

Date / Time of Inspection:

Type of Report:

Warranty (Defect) inspection

Address of Property:

Client Details

Client Name:

Client Email Address:

Client Phone:

Real Estate Agent Details

Agent Name:

Company:

Mobile:

Email Address:

Inspector Details

Inspector Name:

Inspector Office:

Inspector Phone:

Inspector Email Address:

APBI

Warranty (Defect) inspection report

Australian Property & Building Inspections offers property inspection services for your property, by highly qualified inspection experts. Each of the inspectors agrees to comply with and are performance managed against APBIs Code of Conduct. For further information about your report call 1300 657 546 or for further information on our code of conduct please visit https://www.apbi.com.au/code-of-conduct



TABLE OF CONTENTS

1. Description of property	4
2. Definitions	6
3. Inspection Agreement	7
4. Terms & Conditions	9
5. Hallways and general living spaces	11
6. Kitchen	18
7. Laundry	21
8. Bedrooms	23
8.1. Bedroom 1	23
8.2. Bedroom 2	26
8.3. Bedroom 3	28
8.4. Bedroom 4	30
9. Bathrooms	32
9.1. Bathroom 1	32
9.2. Bathroom 2	34
10. Ensuite	36
10.1. Ensuite 1	36
11. External of property > Exterior	39
12. External of property > Roof are a	45
13. External of property > Sylv floor reas	49
14. Findings and summary	54
15. Australian Property And Suilding Inspection	55

1. Description of property

Brief description of the building and other structures on the property:

Туре:	Domestic	Freestanding House
Bedrooms:	4	
Bathrooms:	2	
Ensuites:	1	
Car Park:	Triple	
Height:	Single Story	
Building:	Brick Veneer	4
Piers:	Concrete	
Floor:	Timber with concrete ar	reas
Roof:	Metal	
Age:	New build	
Image of property:		M.
YEL.		



Weather at	time of inspection?
Fine	
Was the pr	operty furnished at time of inspection?
Yes	
Please note:	To conduct an inspection in accordance with AS 4349.1 the property would be vacant of all furnishing to enable a thorough visual inspection.
Was there	evidence of any extensions at time of inspection?
No	
Comment:	
	onnected to property
Electricity:	Yes
Comment:	
Gas:	Yes
Comment:	
Water:	Yes
Comment:	
Sewer:	Yes
Comment:	
Drainage:	Yes
Comment:	
Smoke Detect	es
Comment:	

2. Definitions	
Definition of terms used	to describe the current state of repair for each item inspected
Condition Visually Fine:	When the Inspector has viewed the subject area and sees no major defect, and sees no safety hazard.
Minor and/or Major Defect	Any defect observed to the property in accordance with the Standards and Tolerances where applicable, where repair works must be carried out. Repairs should be carried out by a suitably qualified or licenced trades person.
Incomplete Item	Any item that is deemed incomplete at the time of the inspection, but not deemed a defect at that time.
Unable to Inspect Due to Access	An area of the site where there is insufficient, unsafe or unreasonable access.
Not Applicable (N/A):	When the subject field doesn't make up any part of the inspected proper v.
Report Definition	
Shower Recesses:	Tests may be made on shower recesses to detect leeks (if a pter is connected). The tests may not reveal leaks or show incorrect waterproof in a single of the inspection. Such applied on its temporary waterproofing measure and may last for some months before bleaking low. The tests of shower recesses are limited to running water within the relesses and issually checking for leaks. As shower are only checked for a short period of tine, prolonge use may reveal leaks were not detected at the time of inspection. No evidence of a current leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during inspection does not necessarily mean that the shower does in the leak during in the leak during inspection doe
Glass Caution:	Glazing in some building (built before 1978) may not necessarily comply with current glass safety standards AS128. In the interests of safety, glass panes in doors and windows especially in high traffic and a should be replaced with safety glass of have shatterproof film installed.
Stairs & Balustrades:	The Australian Burling Code 3.9 require that covering stairs, landings and balustrades ensure the san ty of Nord pants and visitors to a building. Those built prior to 1996 may not couply with the current standard. You must upgrade all such items.
Swimming Pools:	A) This statect to a special purpose property report and is not applicable to this report.
Rooms Below Ground Level:	room under the house or below ground level (whether they be habitable or not) may be subject to dampness and water penetration. Drains are not always installed correctly to ese areas or could be blocked. It is common to have damp problems and water entry into these spaces, especially during periods of heavy rainfall and may not be evident on the day of the visual inspection. These rooms may also not have council approval. The purchaser should make their own enquiries to Council to ascertain if approval was granted.

If the property is covered by an Owners Corporation (Strata Title) APBI recommend that an Owners Corporation search be conducted to ascertain their financial position, the level of maintenance afforded and any other relevant information that may impact your future ownership of the property.



Owners Corpo

3. Inspection Agreement

Requirement for inspection agreement

AS 4349.1 - 2007 requires that an inspection agreement be entered into between the inspector & the client prior to the conduct of the inspection. This agreement sets out specific limitations on the scope of the inspection and on limits that apply in carrying it out. Where specific State or Territory requirements apply in addition to the scope of work in this agreement, or where the inspector and client agree to additional matters being covered, that additional scope is listed at the end of this agreement. It is assumed that the existing use of the building will continue.

AS 4349.1 - 2007 requires that the basis for comparison is a building of similar age and similar type to the subject building and which is in reasonable condition, having been adequately maintained over the life of the building. This means that building being inspected may not comply with Australian Standards, building regulations or specific state or territory requirements applicable at the time of the inspection.

Purpose of inspection

The purpose of the inspection is to provide advice regarding the condition of the property at the time of the inspection.

Reasonable Access to the property at time of inspection?

was not inspected and the factor that prevented inspection.

Note: However, roof space inspection was limited by low clearance, due Yes and insulation in places.

Areas where reasonable entry is denied to the inspector or where reasonable access form part of the inspection. Access limitations may include legal right of entry, locked excluded from and do not system, pets, furniture or other obstructions. Physical access limitations may include height, narrow b ance, thick vegetation, small roof or crawl space and adverse weather conditions. The report shall identify any in the scope of the inspection that

The extent of accessible areas shall be determined by the inspector at the me of inspe tion based on the conditions encountered at that time. The inspection shall include only accessible are ind areas nat are within the inspector's line of sight and close enough to enable reasonable appraisal.

Reasonable access includes a prerequisite that the minimum cl rances specified in the table below are safely available. Dimensions for reasonable access:

- Roof Interior: 400mm x 500mm access hole; 600mm x 600 awl sp
- ce; and accessible from a 3.6m ladder; ace; and accessible from a 3.6m ladder placed on the Roof exterior: 400mm x 500mm access hole; 600mm x 600m ground Supplementary notes:

- · Reasonable access does not include the es or the removal of screws and bolts or any other fastenings or sealants to access covers.
 - Sub-floor areas sprayed with chemic be inspected unless it is safe to do so.



Conditions

An inspection report may be conditional on:

- Prevailing weather conditions or recent occupancy and use of services that mightaffect observations.
- Information provided by the client or agents of the client.
- · Deliberate concealment of defects.
- · Any other relevant factor limiting the inspection.

Scope of inspection

What is not reported on, general exclusions detailed in AS 4349.1 - 2007

- · Parts of a building that are under construction;
- The inspection is not intended to include rigorous assessment of all building elements in a property;
- Defects that would only be apparent under particular weather conditions or when using particular fittings & fixtures;
- Defects not apparent due to occupancy or occupancy behaviour e.g. non-use of a leaking shower;
- The inspection report is not a certificate of compliance of the property within the requirements of any Act, regulation, ordinance, local law or by-law and is not a warranty against problems developing with the building in the future;
- Unauthorized building work or of work not compliant with building regulations;
- Title and ownership matters, matters concerning easements, covenants, restrictions, zoning certificates and all other lawrelated matters:
- Estimation of the cost of rectification of specific defects.

What is not reported on, specific exclusions detailed in AS 4349.1 - 2007

- Footings below ground, concealed damp-proof course, electrical installations, operate and fittings, TV, sound and communication and security systems, concealed plumbing, ade oke det tors, light switches ı of rainage as installed, gas fittings and fixtures, air conditioning, automatic garage door mechanisms, swimming poo ociated filtration and similar equipment;
- The operation of fireplaces and solid fuel heaters, including chimneys and flues, a m systems, intercom systems, soft floor coverings, electrical appliances including dishwashers, incinerators, ovens, systems, paint coatings except external protective coatings, health hazards e.g., allergies, soil toxicity, lea content presence of asbestos or urea formaldehyde), timber and metal framing sizes and adequacy, concealed bracing, timber pest activity, other e downs an mechanical or electrical equipment (such as gates, inclinators);
 • Soil conditions, control joints, sustainable development provisions, con
- ling-timbers or any areas concealed by led fr and accessor wall linings or sidings, landscaping, rubbish, floor cover, furnitur ored items, insulation, environmental nergy efficiency, lighting efficiency. matters e.g. BASIX, water tanks, BCA environmental provisions

What is reported on

The inspection includes subjective appraisal by an inspector cominvolves a subjective assessment so different inspections or even the to assess the condition of residential buildings. It or even the ame inspector on a different occasion may reach different

The inspection comprises a visual assessmen dentify major defects and to form an opinion regarding the general condition of the property at the tin of insp e following areas shall be inspected where applicable: ction.`

- The interior of the building: ceilings ılls; rs; windows; doors & frames; kitchen; bathroom; WC; ensuite; laundry; stairs & damp problems;
- The exterior of the building: walls (in t lint is, claddings, doors & windows); timber or steel frames & structures; ks, suspended concrete floors, balustrades; chimneys; stairs; balconies, ver pat
- ngles & slates, roof sheeting, gables, flashings); skylights, vents, flues; valleys; The roof exterior: roof (include) guttering; downpipes; eay
- The roof space: roof d g; roo ming; sarking; party walls; insulation;
- The sub-floor space: ti
- (including supports, floor, ventilation, drainage, damp); suspended concrete floors; ne house and within the boundaries of the site: car accommodation, detached laundry, ablution • The property within 30 facilities and ga aining walls (where supporting other structures and landscaping retaining walls > 700mm high); heds; paths & drivey ng (general & swimming pool); surface water (drainage effectiveness).

4. Terms & Conditions

APBI Terms & Conditions

General

- 1. Australian Property and Building Inspections (APBI) has prepared this report in accordance with the guidelines of **Australian Standard 4349.1 2007 Inspection of buildings Part 1: Pre-purchase inspections Residential Buildings** (the Standard) which covers the minimum requirements for the visual inspection of residential buildings and based on the inspection of the property by the Inspector named in the building inspection report.
- 2. The Report is prepared for the sole and exclusive use of the Client (person, persons or body) named in the Booking Confirmation and cannot be used or acted upon by any other party without the express permission of APBI.
- 3. The Terms and Conditions are available on the website: www.apbi.com.au and can change without notice.
- 4. The Client, having been provided with the opportunity to read these Terms and Conditions following the making of a booking and a payment for an inspection, accepts these Terms and Conditions.
- 5. The Client acknowledges that these Terms and Conditions take precedence over any oral or written representations made by APBI or the Inspector, to the extent of any inconsistency.
- 6. A report prepared in accordance with the Standard is not a certificate of compliance of the property within a requirements of any Act, regulation, ordinance, local law or by-law, or as a warranty or an insurance policy against problems developing with the building in the future.

The Inspection

- 7. All inspections will be a **non-invasive visual** inspection and will be limited to the Reasonable Access (see below) is both available and permitted on the date and time to Inspection.
- 8. The inspection is undertaken, and the Report prepared, by the Inspector in the asympton that the existing use of the Inspected Property will continue. As such, the Inspector will not assess the itness of the Inspected Property for any other intended purpose. We advise you to verify any proposed change in use of the Inspected Property with the relevant authorities.
- 9. Where the Inspected Property is a unit or apartment (Strata Tiths), inspected will be limited to the nominated residence and does not include common property. i.e. Only those items lived on the title shall be reported.
- 10. The Inspected Property shall be compared with a building that has constructed in accordance with the generally accepted practice at the time of construction and which has been maintened such that there has been no significant loss of strength and serviceability.

Reasonable Access

- 11. The Standard provides that "safe and reconable access chall be determined by the inspector at the time of the inspection, based on the conditions encountered at the time of aspection. An inspector shall only inspect areas where safe, unobstructed access is provided and where the minimum classifiers are available or, where these clearances are not available, areas within the inspector's unobstructed line of sight all those is pugh to enable reasonable appraisal.
- 12. Minimum clearances are defined as at least 30mm vertical and horizontal clearance for roof space and sub floor area access. The interior and exterior roof multiple scelable from a 3.6 metre high ladder for reasonable access to be available.
- 13. Reasonable access do that include removing screws and bolts to access covers. Nor does reasonable access include cutting or making access traps or took furniture or stored goods.

Limitations

- 14. **No assessi** enter data tification is made of asbestos or asbestos related products, toxic mould, Methamphetamine or other harmful substances. Asbes is dust is a hazardous material and should not be disturbed. It is vital that asbestos is not sawn, sanded, drilled or water by asted, etc. For more information about the handling and disposing of asbestos contact your local council.
- 15. Our inspection does not assess the operation of appliances, alarms, security and communication systems, smoke detectors, heating and cooling systems, blinds (internal and external), soft furnishings, telephones, spa and pool equipment, building automation, electrically operated doors, plant and equipment. Any item not specifically noted in this Report is excluded from the inspection of the Inspected Property. We suggest that a licensed tradesperson be contacted for a separate report in respect of gas or electrical appliance and fittings.
- 16. No item of furniture or fixtures will be removed, moved or modified during the inspection and items and conditions covered by such furnishings and fixtures are not inspected or considered. Nor do we assess the condition of conspicuous, non-structural items such as carpets, vinyl floor coverings etc.
- 17. The Inspector can only make comment about the general, visible condition of electrical wiring and plumbing. We suggest that a licensed tradesperson be contacted for a separate report.

The Inspection Report

18. The Report must be read carefully and, in its entirety, to gain a complete understanding of the findings of the inspection of the Inspected Property. It will help you understand the limitations faced by an inspector and why it is not possible to guarantee that a property is completely free of defects.



- 19. This Report describes the visual assessment of the Inspected Property including: the relevant features of the Inspected Property within 30m of the building and within the boundaries of the site, the prevailing structural, soil and weather conditions at the date and time of the inspection.
- 20. The Report is a subjective assessment of the Inspected Property and therefore outlines the opinion of the Inspector on the general condition of the Inspected Property at the date and time of the inspection in relation to major defects or safety hazards and a general advice on minor defect items.
- 21. The Report does not cover any part of the building located beneath the ground surface or identify any unauthorised building work or of work not compliant with building regulations.
- 22. An estimate of the costs of rectification of defects is not required in accordance with the Standard.
- 23. Any maintenance and general advice items are intended as a helpful guide. The Report is not an exhaustive list of all maintenance and advice items.
- 24. The Report provides no guarantee and is not a warranty against problems developing with the Inspected Property in the future.
- 25. This Report is not a rigorous assessment of all building elements and does not cover all maintenance items. This Report also does not cover defects in inaccessible areas, defects that are not reasonably visible, defects that may only the apparent in certain weather conditions or defects that have not yet arisen due to prolonged periods of wet or dry weather or of the subsequent events.
- 26. The Building or Pre-purchase Inspection Report does not identify the presence of timber pests, or any dange caused by timber pests (e.g. termites, borers, etc.). If you wish to include this, you will need to request a Timber Pest inspection report. If there is a concern regarding other types of pests then a fully qualified Pest Controller should a contacted.

Other matters

- 27. You should address legal and conveyancing matters such as title and ownership and conveyancing matters. Compliance issues in relation to the positioning of services, privacy, vehicle access, the siting or the buildings, zoning, permit or town planning issues or other legal matters should be directed to the relevant sity to a solicitor or legal representative.
- 28. Unless otherwise notified, Australian Property & Building Inspections vall make vehor purchased reports available to prospective buyers. Please advise within 48 hours of receipt of this report lass a vendo you do not wish this report to be made available to prospective purchasers of the property.



5. Hallways and general living spaces Condition Visually Miner and/or Major Unable to Jacobs Applicable

	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Unable to Inspect Da to Access	Not Applicable (N/A)
Floor		₫			
Walls		Ø			
Ceilings	₫				
Doors		₫	D		
Windows	₫				
Fireplace	₫				
Heater	₫				
Stairs					₫
Balustrade					₫

Minor and/or Major Defect

Floor

Comments

There are scratches, scrapes and discoloured surfaces in several areas, consistent with damage to surface coating of floor laminate timbers.
Recommend resurfacing floor laminate with more durable hard-wearing surface coating that is fit for purpose.



Minor and/or Major Defect

Walls

Comments

Slight shrinkage gaps between joinery elements should be filled and touchup painted, i.e. near the front door, architraves, skirting boards, at window seat architraves.



Minor and/or Major Defect

Doors

Comments

Dents and minor blemishes to framing around sliding doors and windows should be touched up to consistent finish.










Minor and/or Major Defect

Doors

Comments

Adjust the door striker plates to prevent door rattle.



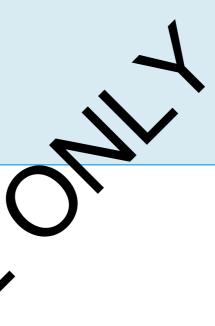

Minor and/or Major Defect

Walls

Comments

Linen cupboard cabinetry - seal gaps between fixed panels and walls.










Minor and/or Major Defect

Comments

Two wall light fittings were loose and should be secured.



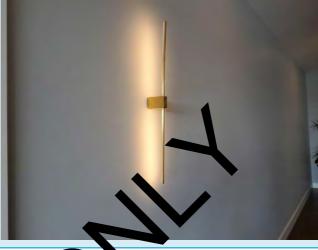

6. Kitchen



		Minor and/or Major	Incomplete Item	Unable to Inspect Due	
	Fine	Defect	incomplete item	Access	(N/A)
Floor	₫				
Walls	₫				
Ceilings	₫				
Ground Cabinets		₫			
Overhead Cabinets	₫				
Benchtops	₫				
Drawers	₫				
Sink	đ				
Sink Mixer	I				
Oven	Ø				
Range Hood					
Dishwasher					
Sealants	Ū ·				
Windov					đ
Doors		₫			
Tile or Glass	₫				
Ventilation	₫				

Kitchen

Minor and/or Major Defect

Ground Cabinets

Comments

Clean off minor paint smears, i.e. fridge door and kickboard.





Kitchen

Minor and/or Major Defect

Doors

Comments

Make good butlers pantry doorjamb where hinges were received, to smooth painted finish.





Kitchen


Minor and/or Major Defect

Ground Cabinets

Comments

Microwave cabinet door scrapes left side. Adjust the cabinet doors/drawers so there are consistent margins, and surfaces align.



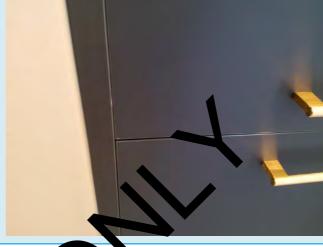

7. Laundry



	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Unable to Inspect Due Access	Not Applicable (N/A)
Floor	₫				
Walls	₫				
Ceilings	₫				
Doors		₫			
Windows	₫				
Trough/Sink	₫				
Taps	₫				
Cabinets	₫				
Sealants	I				
Exhaust Fans	Ø				
Ventilation					

Laundry

Minor and/or Major Defect

Doors

Comments

Repair loose rubber seal. Clean off building debris/marks from door frame.





Laundry

Minor and/or Major Defect

Doors

Comments


Adjust the door striker plate to prevent door rattle, both






8. Bedrooms

8.1. Bedroom 1

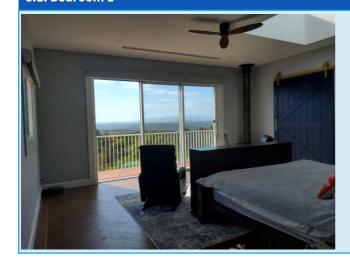

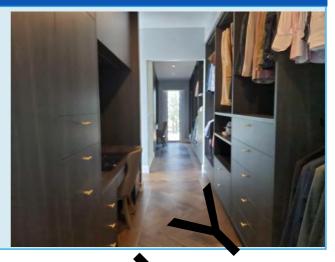

	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Un Netwinspect File	Not Applicable (N/A)
Floor		₫			
Walls	₫				
Ceilings	₫				
Doors		Ø			
Windows		Ø			
Robes	₫	V			
Smoke Detectors	₫				

Bedroom 1

Minor and/or Major Defect

Floor

Comments

Rectify loose brass inselve in relaminate, robe area, two places.





Bedroom 1

Minor and/or Major Defect


Doors

Comments

Some of the sliding door brackets were loose, and should be repaired as soon as possible to avoid further damage and possible collapse.





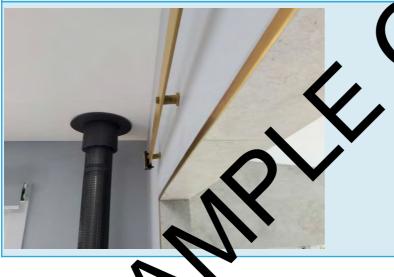



Bedroom 1


Minor and/or Major Defect

Windows

Comments

Touchup surface blemishes to window frame.



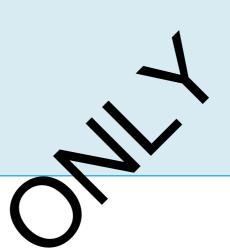

8.2. Bedroom 2



	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Unable to Inspect be to Access	Not Applicable (N/A)
Floor	₫				
Walls	₫				
Ceilings	₫				
Doors		₫	D)		
Windows		ď			
Robes	₫				
Smoke Detectors	₫				

Bedroom 2

Minor and/or Major Defect

Doors

Comments

Adjust the door striker plate 100 vent look attle.



Bedroom 2

Minor and/or Major Defect


Windows

Comments

Fill shrinkage gaps at window mouldings and touchup paint.



8.3. Bedroom 3

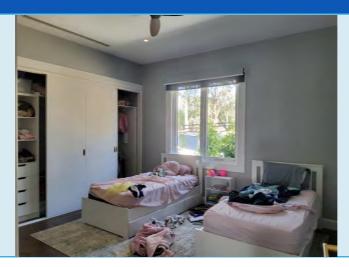

	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Unable to Inspect 2. to Access	Not Applicable (N/A)
Floor	₫				
Walls	₫			\Box	
Ceilings	₫				
Doors		₫			
Windows	₫				
Robes		I			
Smoke Detectors	₫				


Bedroom 3

Minor and/or Major Defect

Doors

Comments

Adjust the door striker plate . Went look attle.

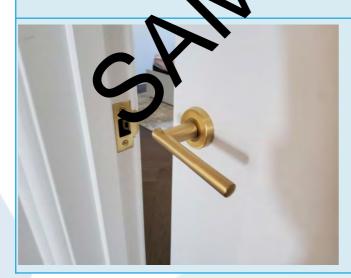

Bedroom 3

Minor and/or Major Defect

Doors

Comments

Touchup paint slight shrinkage gaps at robe architraves.





Bedroom 3

Minor and/or Major Defect

Robes


Comments

Adjust left robe sliding door to align with the doorjamb.





8.4. Bedroom 4

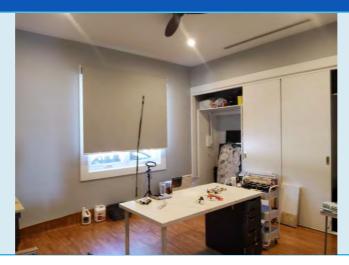

	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Unable to Inspect L. to Access	Not Applicable (N/A)
Floor	₫				
Walls	₫			\Box	
Ceilings	J				
Doors		d			
Windows		Ø			
Robes	₫				
Smoke Detectors	₫				

Bedroom 4

Minor and/or Major Defect

Doors

Comments

Adjust the door striker plate was vent look attle/ to close smoothly.



Bedroom 4

Minor and/or Major Defect

Windows

Comments

Fit chains or other device to control blinds.





9. Bathrooms

9.1. Bathroom 1



	Condition Visually Minor and/or Major Unble Unspect Pue Not Applicable					
	Fine	Defect	Incomplete Item	Un ble \ Inspect Pile 'o Ac. \ss	Not Applicable (N/A)	
Shower Recess					₫	
Bath					₫	
Floor	₫					
Walls	₫					
Ceiling	₫					
Breech Combo					₫	
Bath Outlet					₫	
Shower Screen					₫	
Cabinets	Ø					
Mirrors						
Exhaust Fan	Ø					
IXL Tastic					₫	
Sealan	▼					
Basins	ď					
Mixer Taps	₫					
Shower Rose					₫	
Windows					₫	
Doors	₫					
Toilet Roll Holder		Ø				
Towel Rail	₫					
Toilet	₫					
Ventilation	₫					

Bathroom 1


Minor and/or Major Defect

Toilet Roll Holder

Comments

Straighten and tighten toilet roll holder.



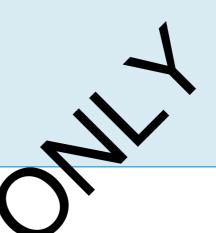

9.2. Bathroom 2



	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Unable to Inspect Landon to Access	Not Applicable (N/A)
Shower Recess	₫				
Bath	₫				
Floor	₫				
Walls	đ				
Ceiling	₫				
Breech Combo					ď
Bath Outlet	J				
Shower Screen	J				
Cabinets	d				
Mirrors	₫ 🖍				
Exhaust Fan	A				
IXL Tastic	Ŀ				
Sealants	\X'				
Basins	ď				
Mixer Tap.	₫				
Shower Rose	đ				
Windows	₫				
Doors		Ø			
Toilet Roll Holder		Ø			
Towel Rail	₫				
Toilet	₫				
Ventilation	₫				

Bathroom 2

Minor and/or Major Defect

Doors

Comments

Adjust the door striker plate to prevent door rattle.





Bathroom 2

Minor and/or Major Defect

Toilet Roll older

Comments

Straighten and tighten toilet roll holder.



10. Ensuite

10.1. Ensuite 1





	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Un 'sle to 'nspect 's Je n Aco (35	Not Applicable (N/A)
Shower Recess	₫				
Bath	₫				
Floor	₫				
Walls		Ø			
Ceiling	₫				
Breech Combo	₫				
Bath Outlet	₫				
Shower Screen	₫ 🛕				
Cabinets		Ø			
Mirrors					
Exhaust Fan	$\overline{\mathbb{Q}}$				
IXL Tastic	Ø				
Sealant	▼ ☑				
Basins	ď				
Mixer Taps	₫				
Shower Rose	₫				
Windows	₫				
Doors		Ø			
Toilet Roll Holder	₫				
Towel Rail	₫				
Toilet	₫				
Ventilation	₫				

Ensuite 1

Minor and/or Major Defect

Cabinets

Comments

Adjust the tiled cabinet doors/drawers so there are consistent margins, and surfaces align. Lower edge was scraping the frame.





Ensuite 1

Minor and/or Major Defect

Walls

Comments

Above the tiled cabinet door, fill tile joint with grout to a constent hish.



Ensuite 1


Minor and/or Major Defect

Doors

Comments

Adjust the toilet door striker plate to prevent door rattle.



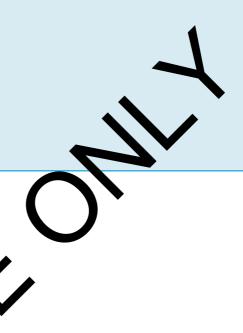

11. External of property > Exterior							
	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Unable to Inspect Due to Access	Not Applicable (N/A)		
Walls		₫					
Windows	₫						
Doors	₫						
Fascia, Eaves, Bargeboards		₫					
Down Pipes	₫						
Deck, Verandah, Balcony, Patio	₫						
Steps	₫						
Handrails	₫						
Pergola					<u>d</u>		
Driveways and Paths			ď				
Retaining Walls	₫						
Garage/Car Port		Ø					
		8/					
Ç							

Minor and/or Major Defect

Walls

Comments

Timber boards around the subfloor area have shrinkage gaps between boards, and some twisting movement, and should be refixed, gaps filled and touchup paint to a consistent finish.



Minor and/or Major Defect

Fascia, Eaves, Bargeboards

Comments

Touchup paint soffit outside main bedroom.





External > Exterior

Minor and/or Major Defect

Fascia, Eaus, Barge pards

Comments

Seal the gaps between soffit and angled window top fram





Incomplete Item

Driveways and Paths

Comments

Driveway and paths finished hard surface not yet built.





External > Exterior

Minor and/or Major Defect

Garage/Car Port

Comments

Repaint where paint surface was damaged.



Minor and/or Major Defect

Garage/Car Port

Comments

Very slight crack (Category 1 - less than 1mm) noted.
As per VBA Guide to Standards and Tolerances, "Cracks to slabs are to be monitored for a period of 12 months. At the end of the monitoring period, cracks are defective if they are greater than category 2 (more than 2mm width) and attributed to the actions of the builder."



Minor and/or Major Defect

Site Drainage

Comments

Site drainage along the higher (western) side of the house appeared to be inadequate, as there was significant areas of damp ground below the house, especially alongside the west brick wall.

Damp subfloor conditions must be prevented in accordance with BCA requirements.

Recommend a structural engineer specify site drainage (suitable for the soil type and footings detail). Site drainage should be provided by the builder / drainage contractor, to ensure that the structural integrity of the house and footings is maintained in the long-term.









12. External of property > Roof areas

Roof Type: Timber truss





	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Una le to rspect de Acco	Not Applicable (N/A)
Roof Space		₫			
Roof	₫				
Valleys	₫				
Flashings	₫				
Gutters		I			
Pointing					₫
Skylights					₫
Vents		Ø			
Chimney	Q				
Ç					

External > Roof Areas

Minor and/or Major Defect

Roof Space

Comments

Replace insulation batts where some have been moved to comply with BCA energy efficiency requirements.





External > Roof Areas

Minor and/or Major Defect

Gutters

Comments

Water was pooling in the gutter on the south side of outdorr overedorea, more than 10mm water pooling is defective. Repair gutter grading to ensure water drains to the downpip





External > Roof Areas

Minor and/or Major Defect

Vents

Comments

No roof vents were installed. Install ventilators for the roof space to minimise the risk of condensation and other damp issues, in accordance with BCA requirements.





13. External of property > Sub floor areas



	Condition Visually Fine	Minor and/or Major Defect	Incomplete Item	Unable to Inspect Due Access	Not Applicable (N/A)
Sub Floor Ventilation	₫				
Stumps		Ø			
Framing		₫			

External > Sub Floor Areas

Minor and/or Major Defect

Stumps

Comments

Timber supports in two places alongside the from brick wall were in ground contact, and wet condition. This is conducive to termites and fungal decay, and can allow to mite conceal d pathways from the ground into the house.

Replace timber supports with durable materials and provide termite protection in accordance with Australian standard AS3660.1.





External > Sub Floor Areas

Minor and/or Major Defect

Framing

Comments

Timber framing around the perimeter walls were in ground contact and also conducive to termites. Keep ground at least 75mm below timber framing.









External > Sub Floor Areas

Minor and/or Major Defect

Stumps

Comments

Subfloor ventilation appeared adequate, however there was significant areas of damp ground below the house, especially alongside the west brick wall (see Site Drainage comment in the external areas section of report). Damp subfloor conditions must be prevented in accordance with BCA requirements to ensure that the structural integrity of the house stumps and footings is maintained in the long-term. Recommend a structural engineer specify site drainage (suitable for the soil type and footings detail). Site drainage should be provided by the builder / drainage contractor to prevent damp ground conditions below the house.





















Minor and/or Major Defect

Comments

No damp proof membrane was fitted between some brick engaged piers and timber bearers. Damp proof membrane should be installed where missing to prevent damp deterioration to timber beams.











14. Findings and summary

This Building Inspection summary provides you with a "snapshot" of the items the inspector considers of greatest significance for you, in respect of the building only, when considering this property. Please refer to the Definitions and the complete Report for detailed information regarding visible defects. Note that this Summary is not the complete Report and that in the event of an apparent discrepancy the complete Report overrides the Summary information.

Report Summary

The house construction appeared substantially solid and well finished. However some cosmetic (minor) defects were found to be rectified, and a few more significant defects should be rectified to avoid future potential damage. Please see all comments in the body of report.



Major Defects Noted

Yes

A defect of sufficient magnitude where rectification has to be carried out who put und be delay to avoid: unsafe conditions, posing a threat to life or serious injury; loss of utility, whereby the defect is such that the color of the relevant part of the building can no longer serve its intended function; or further substantial determation of the building.

Site drainage, damp ground conditions below the house, in the stumps, damp proof membrane over engaged piers.

Major Structural Defects Noted

No

A major defect in any internal or external by mary and bearing component of the building which seriously affects the structural integrity of the building requiring rectification to be carried out without undue delay to avoid: unsafe conditions, posing a threat to life or serious injury; loss of the component of the building can no longer serve its intended function; or function has until deterioration of the building. In the case of cracking, a serious structural defect denotes severe cracking as defined. Category 4, Appendix C – Australian Standard AS 2870-2011. Appendix C is attached for your reference.

If major defects are not core sed, structural damage may eventually occur.



15. Australian Property And Building Inspection

The Australian Property & Building Inspections is a national organisation that promotes quality building inspections. APBI engages with trade qualified builders with a minimum of 10 years residential and commercial building experience to complete property inspections. Each home and building inspection completed is then detailed in a report that is completed to Australian Standards AS4349.0, AS4349.1 and/or AS4349.3. APBI currently has 17 offices nationally who are supported by a national call centre located at Level 6, 350 Collins Street, Melbourne. Our office locations follow:

